Noise at work experts since 1969

Pulsar vB²

Human Vibration Meter User Manual



pulsar
Instruments Plc

Table of Contents

1 Introduction 5

2 Frequency weighting filters 6

2.1 Hand-arm vibration (HAVS) 6

2.2 Whole-body vibration (WBV) 6

3 Accelerometers 8

3.1 Connecting and disconnecting the accelerometer 8

3.2 Accelerometer types 8

Hand-arm vibration 8

Whole-body vibration 8

3.3 Calibration service 9

4 Measuring vibration 10

4.1 Mounting the hand-arm accelerometer 10

4.2 Vibration direction 10

4.3 Choosing a measurement range 11

4.4 Under-range and overload conditions 11

Under-range indication 11

Overload indication 12

5 Getting started 13

5.1 Keypad layout 13

5.2 Power supply 13

Battery level indicator 14

5.3 Switching on and off 15

5.4 Automatic power-off 15

5.5 Display icons 16

5.6 Icon locations 16

6 Using the meter 18

6.1 First-time setup 18

6.2 Connecting the accelerometer 18

6.3 Sensor connection check 19
6.4 Operating modes 19
6.5 Real-time mode 19
6.6 Recording measurements 20
Time history off (timer on or off) 20
Time history on (timer on or off) 20
Time history off (timer enabled) 20
Time history on (timer enabled) 21
6.7 Stopping a recording 21
Saving the recording 21
Discarding the recording 21
6.8 Reviewing saved measurements 21
Exiting file review 22
6.9 Automatic playback 22
7 Software 23
8 Menus and settings 24
8.1 Menu navigation and settings 25
8.2 File manager 25
8.3 Loading a file 26
Filter selection 26
8.4 Deleting a file 26
8.5 Deleting all files 27
8.6 Automatic playback 28
8.7 Automatic file naming 28
8.8 Hand-arm and whole-body setup 28
Range 29
Results selection 29
Data recording 29
Time history disabled 30
Interval 30

Timer setup 31
8.9 Exposure values 31
Hand-arm exposure values 32
Whole-body exposure values 32
8.10 Channel setup 32
Axis 33
Scaling 33
8.11 Calibration 33
External calibrator 34
Manual calibration input 34
Calibrator level 35
8.12 General settings 35
Units 36
8.13 Screen 36
Brightness 37
Screen colour 37
Auto dim 37
8.14 Date 37
8.15 Time 38
8.16 Language 38
8.17 Restore defaults 39
8.18 Information 39
9 Measurement screens 40
9.1 Measurement screen 1 40
9.2 Measurement screen 2 40
9.3 Measurement screen 3 41
10 Customer support 43
10.1 Warranty and after-sales service 43

1 Introduction

Thank you for purchasing your Pulsar vB² vibration meter from Pulsar Instruments plc.

Your new vibration meter is at the forefront of design and technology, yet it was developed for seamless, intuitive operation without the unnecessary complexity of traditional vibration meters.

It boasts a high-resolution, large colour LCD with simple, clear visual data representation, and advanced data-recording capabilities that store your data in the large internal memory at your disposal.

It includes a simple plug-in accelerometer, carry strap, and responsive membrane keypad, all housed in an elegant, balanced, practical case developed specifically for this application. The case, accelerometer and cable are all designed for industrial use.

Operation of your Pulsar vB² is simple and requires minimal button pressing. To start recording, simply power the instrument and start recording.

The Pulsar vB² gives you choice when analysing your data, so you can always choose the most effective solution for your needs.

The latest version of vBPlus is available to download free of charge from the Pulsar Instruments website at https://pulsarinstruments.com/software/vbplus-vibration-analysis-software/. This easy-to-use PC-based software provides a comprehensive solution for vibration data analysis.

With the Pulsar vB², combating HAVS and WBV has never been so easy; welcome to the new era in vibration level measurement.


2 Frequency weighting filters

The human body's response to vibration changes depending on the vibration frequency and where it contacts the body.


Your Pulsar vB² Vibration meter has the following frequency weighting filters, which are applied to the measured vibration signal using digital processing for superior accuracy.

2.1 Hand-arm vibration (HAVS)

Wh

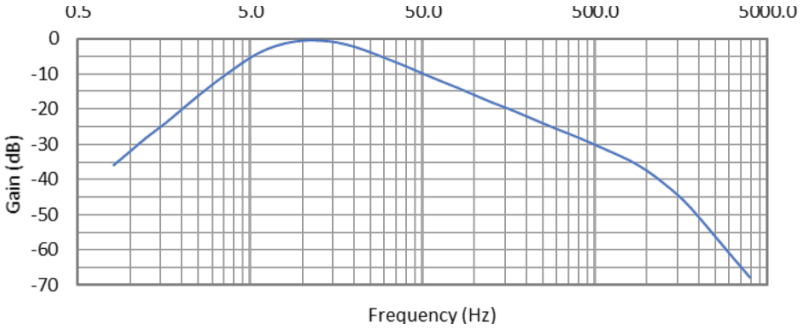


Wh Band Limited

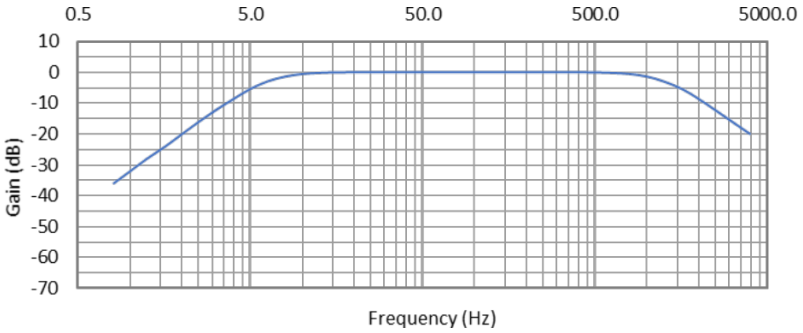


2.2 Whole-body vibration (WBV)


Wd

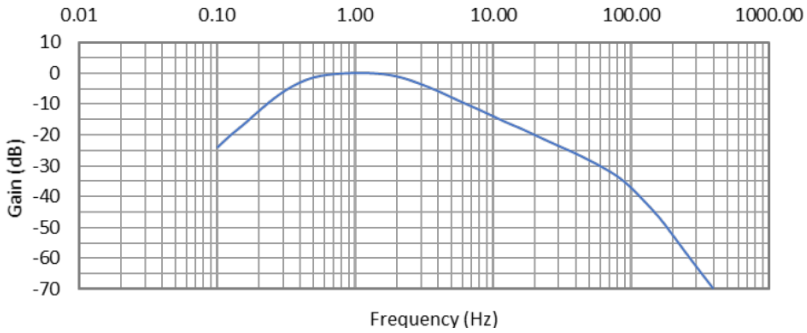


Wd Band Limited

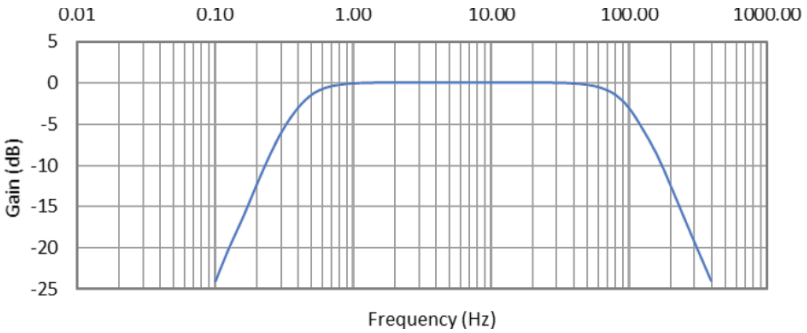

Wk

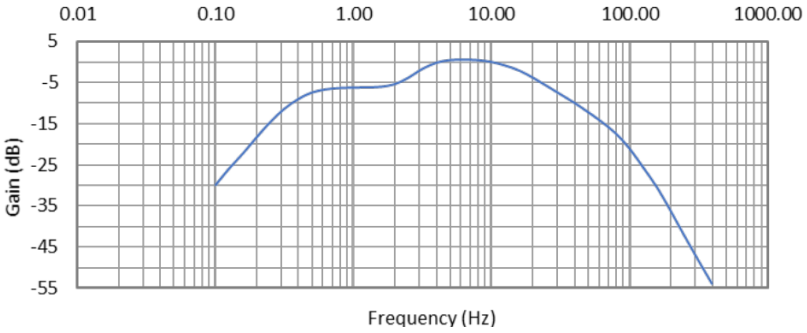

Wk Band Limited

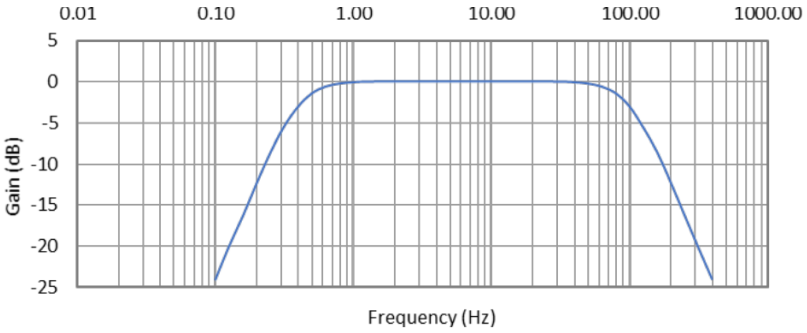

3 Accelerometers

Accelerometers are precision components that can be easily damaged if used incorrectly. Use the instrument with great care to ensure the accelerometer's longevity.

3.1 Connecting and disconnecting the accelerometer

Align the orientation keys between the accelerometer cable and instrument socket, easily identified by a Red marking, then gently push the accelerometer cable into the instrument socket.

To unlatch and remove the accelerometer cable, gently pull on the knurled part of the stem and pull the accelerometer from the instrument.

Do not twist the connector; doing so will likely damage internal wiring.

Removal of the accelerometer can be achieved with the instrument powered on or off.

To prevent damage to your Pulsar vB² Vibration Meter or your transducer assembly, never attempt to twist the connection point.

3.2 Accelerometer types

The accelerometers for use with the Pulsar vB² produce a Voltage Output proportional to the signal being measured.

The table below shows the output voltage and specifications for the accelerometer, where g is the acceleration due to gravity on the Earth's surface and is defined as 9.80665 m s-2.

Acceleration is measured in metres per second squared (m/s/s), which can be written as either of the following: -

- ms^{-2}
- m/s^2

Hand-arm vibration

VB202 : 1mV/g +/-500g , 1Hz to 5kHz

	m/s^2	g	ft/s^2
Low	0.20 – 2000	0.02 – 200	0.656 – 6560
High	1.00 – 10000	0.1 – 1000	3.28 – 32800

Whole-body vibration

VB203: [980.66mV/g] , 0.1Hz to 100Hz , 0.01m/s ^{2}to 5m/s ^{2}PEAK

	m/s^2	g	ft/s^2
Single Range	0.01 – 35	0.001 – 3.5	0.0328 – 115

3.3 Calibration service

The calibration process includes the transducer and vibration level meter. Any change in this measurement chain will require a new calibration certificate.

Pulsar Instruments plc offers a complete calibration service.

We recommend calibrating your vibration meter instrumentation annually to ensure your measuring equipment is accurate and fully compliant.

4 Measuring vibration

To ensure measurements are as accurate and repeatable as possible, always tighten the cable securely to the accelerometer and mount the accelerometer as securely and as flush as possible to the vibration source. Also attach the accelerometer's trailing cable to the vibration source without creating a potential hazard for the operator or others.

Where possible, always mount the accelerometer as near to the centre of where the operator holds and grips the vibration source. In reality, this is not always possible, so you must find the best compromise.

Measurement durations depend on the vibration source, and a minimum period of 30 seconds is recommended for Hand-Arm Vibration. Measurement periods of 3 to 15 minutes are often used for whole-body vibration. These longer durations will improve the accuracy and repeatability of your results.

4.1 Mounting the hand-arm accelerometer

Attach the supplied mounting block to the Hand-Arm accelerometer using the supplied screw, and tighten it with a Hex Key. The mounting block can then be mounted to the vibration source using hose clamps or plastic ties. If plastic ties are used, it is recommended that they are tightened using a tie tensioning tool. Attaching devices such as clamps and the accelerometer to hand-held devices may alter the mass of the vibration source and will inevitably slightly alter the vibration emitted from the device; therefore, keep the mass of hose clips or clamps to a minimum.

Other mounting options include tapping a stud into the vibration source and attaching the accelerometer to the stud.

Alternatively, you may adhere the stud to the device rather than tap it in, using an adhesive that dries rigid.

4.2 Vibration direction

For Hand-Arm vibration, you can measure the three axes in any orientation; however, we recommend using the axes indicated in the figure below. If this is not possible, choosing a different axis orientation is permissible, as you can swap axes in the Channel Setup menu. This will not affect your measured data.

In all cases, it is strongly recommended to note the axes used relative to the vibration source. You will need this information if you implement vibration control on the vibration source.

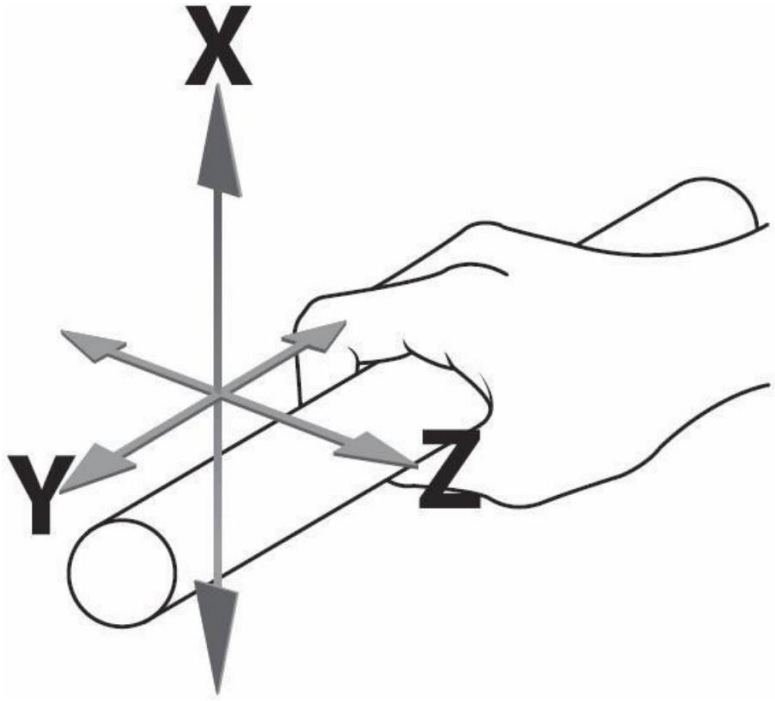


Figure 1: Recommended Axes for Hand-Arm Vibration

4.3 Choosing a measurement range

In some environments, vibration levels may be high. Before you record measurements, take the time to ensure you have selected the optimum range for the process being recorded.

The optimum range is generally the lowest range that can be selected that does not produce an overload condition for the process being monitored.

Where high levels of vibration are encountered, the meter may register an overload, and in these circumstances the meter will display that this has occurred. In such cases, you will need to select the high range to accommodate the higher peak levels. If Overload conditions still occur on the high range, you may need to use an impact filter on the accelerometer.

If the vibration levels are too low for the selected range, the meter will display an under-range condition. Under these circumstances, you will need to select the low range if possible.

For more detailed information, see Under Range & Overload Conditions.

4.4 Under-range and overload conditions

Under-range indication

An under-range condition occurs when the vibration level is equal to or below the bottom of the current range the meter is set to. If this condition occurs, then the UR (Under Range) indicator will be displayed on your instrument. In such circumstances, we recommend switching to a lower range with higher sensitivity, as your meter will be out of specification.

The under-range indicator will remain on for a minimum of 2 seconds for Hand-Arm vibration and 8 seconds for Whole-Body vibration, or while the under-range condition remains.

Overload indication

An overload condition occurs when either the peak input signal approaches the maximum signal handling of the Analogue to Digital converter, the vibration level is set to 95% of its range, or the vibration level exceeds the top of the selected range by 5%.

When an Overload condition occurs, the OL (Overload) indicator is displayed on your instrument.

If an overload condition occurs, it is highly recommended to change to a higher range with a lower sensitivity, as your meter will be out of specification.


The overload indicator will remain on for a minimum of 2 seconds or while the overload condition remains. Overload is latched on for several measurement parameters; this can be cleared with a short key press of the Power key during Real Time operation. During recording, the OL latch cannot be reset.

Please be aware that the selected frequency weighting may attenuate the displayed signal level below the overload triggering point, but an overload can still occur. This is because the overload operates from the unweighted input signal.

5 Getting started

5.1 Keypad layout


Please note that some keys have a dual function.

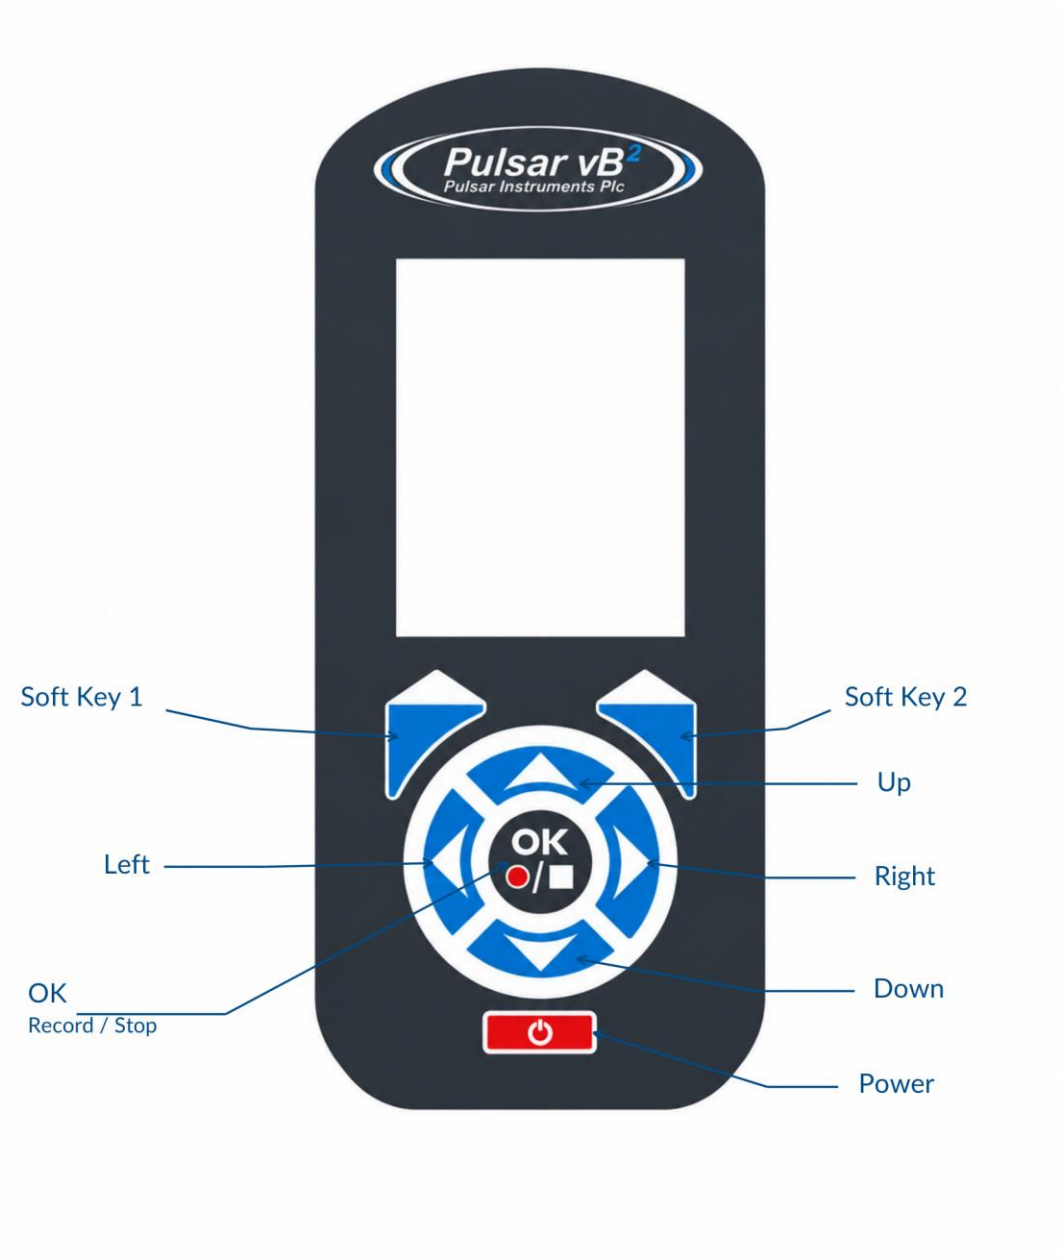

5.2 Power supply

Your Pulsar vB² Vibration level meter can be powered by four 1.5V AA-size batteries or via the micro USB connection through a USB port or similar.


The battery compartment is located at the rear of your Vibration meter. Remove the battery door and insert the batteries using the correct polarity, which is shown where the batteries are fitted and indicated in the image below: -

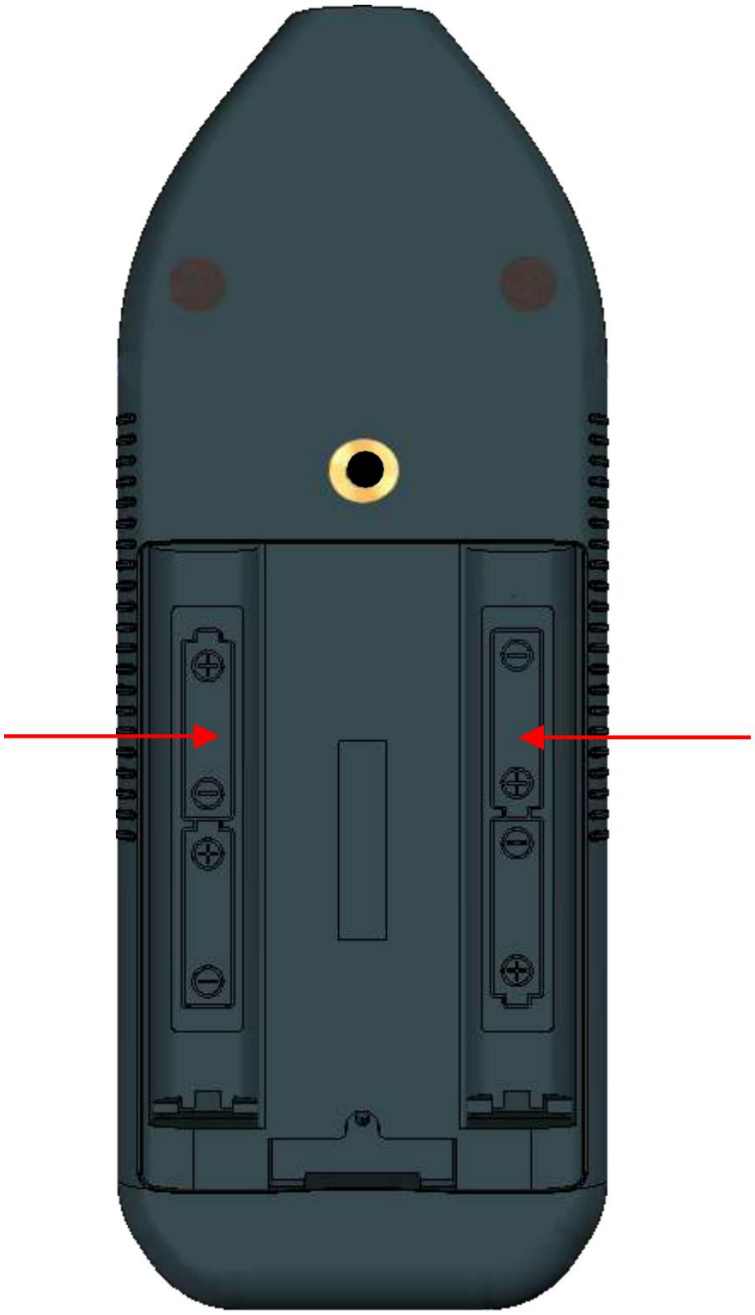


Replace the battery door securely before using the instrument.


Battery level indicator

The Pulsar vB² Vibration Meter is equipped with an approximate multi-level battery indicator as shown below: -

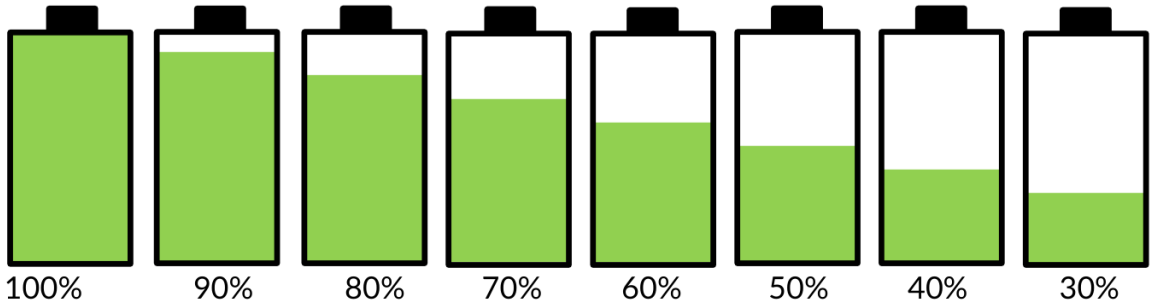

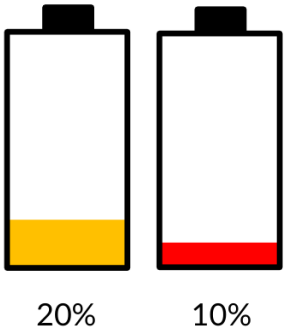

At approximately 5% charge, the battery indicator will flash RED; if the batteries are not replaced, the unit will automatically shut down and save the recording if necessary.

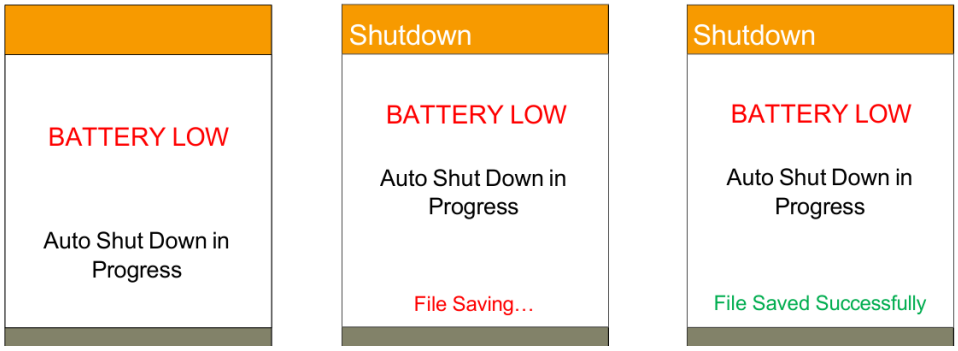

5.3 Switching on and off

In all power configurations, press and hold the Power Key for approximately one second to switch the instrument on.

To switch the instrument off, hold the Power Key down for approximately two seconds and follow the on-screen instructions.

5.4 Automatic power-off

If no key is pressed within three minutes of switching the vibration level meter on, then the unit will automatically power down.

Some screens displayed may not be available on your instrument, depending on your model.

5.5 Display icons

Several icons are used on the Pulsar vB² Vibration Meter to identify the functional or useful settings of the instrument easily: -

LOW	Low Measuring Range Active
HIGH	High Measuring Range Active
	USB Active
	Battery Charge
	Recording Data Active
	File Review Active
HAV	Hand Arm Accelerometer Attached
WBV	Whole Body Accelerometer Attached
	More Measurement Screens Available to View

5.6 Icon locations

The top orange bar on your Pulsar vB² instrument displays most of the information icons, the current time, date, measurement range and the current screen selected: -



The bottom grey bar will display the Record or File Review symbols in a similar position to the image shown below. Note that the image below may have different values from those on your display: -



6 Using the meter


6.1 First-time setup

When you power on your meter for the first time, the instrument will take you through several windows prompting you to confirm basic settings.



Choose your Language, Date & Time settings by using the Up, Down, Left and Right arrow keys to change the selection, and confirm by using Soft Key 2 on each window.

Return to the previous screen at any time by pressing Soft Key 1.

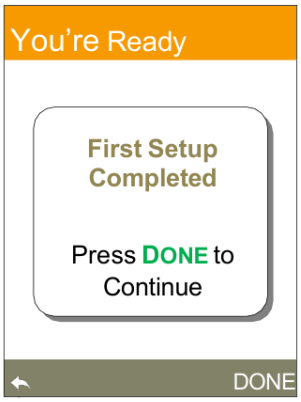

Choose DONE by pressing Soft Key 2 when you're happy with your selection.


Language options are not available on all models.

6.2 Connecting the accelerometer

Each time a transducer is auto-detected, including when powered on with the accelerometer fitted, a 60-second delay occurs to allow the hardware time to settle and adjust to the detected accelerometer.


Please wait until the countdown completes before taking measurements.

Bypassing the delay by pressing Soft Key 2 labelled OK allows access to the menu system; however, we highly recommend waiting 60 seconds before recording data.

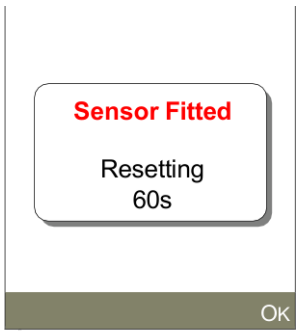

6.3 Sensor connection check

If no transducer is detected, regardless of the active screen, the following is shown. It is removed when an accelerometer is detected or by pressing Soft Key 2 (CONFIRM), which returns the instrument to the previous screen.

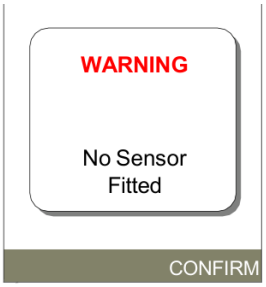

6.4 Operating modes

The Pulsar vB² vibration meter has three primary operational modes; these are: -

- Real Time
- Recording
- File Review

Each mode can be quickly identified by viewing the bottom bar; Real Time has no icon,

Recording has a standard red record symbol, and File Review shows a green directional arrow.

6.5 Real-time mode

This is the standard mode of operation for your Pulsar vB² vibration level meter.

You can access the menu system in real-time mode and change instrument settings if required.

Measurement screens are accessible, but not all parameters are available while real-time mode is active.

Use the Up or Down Arrow keys to scroll measurement screens.

Scroll between measurement parameters using the Left or Right Arrow keys. Use Soft Key 2 to swap between measurement ranges.

Press and release the Power Key to reset parameters in Real Time Mode.

6.6 Recording measurements


Recording data is achieved by pressing the Record key whilst in real time or playback mode.

The settings for recording are applied under Data Recording under either Hand-Arm Setup or Whole-Body Setup.

Data Recording under Hand-Arm and Whole-Body Setup is independent of each other.


Time history off (timer on or off)

If Time History is not enabled for the recording, the bottom bar will only indicate the elapsed recording time: -

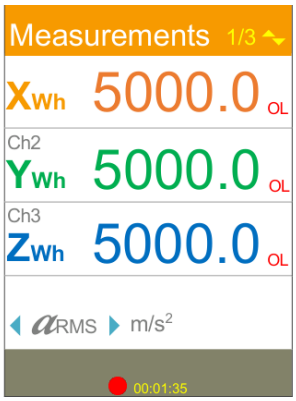


Time history on (timer on or off)

When Time History is enabled for the recording, the bottom bar will display the elapsed recording time and the current interval countdown time: -

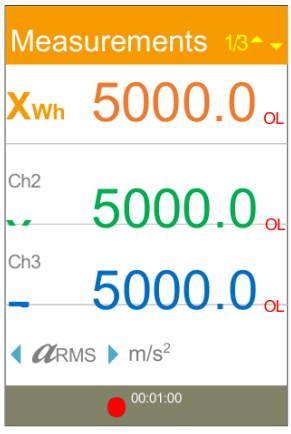


Time history off (timer enabled)

When Time History is disabled for the recording, but the Duration Timer is enabled, the bottom bar will only display the elapsed recording time: -

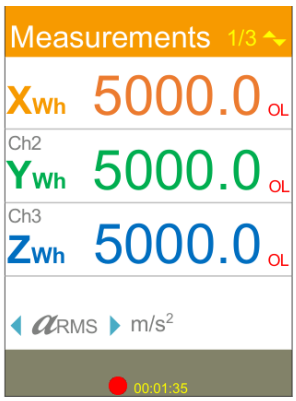

Time history on (timer enabled)

When both Time History and Duration Timer are enabled for the recording, the bottom bar will display the elapsed recording time and the current interval countdown time: -

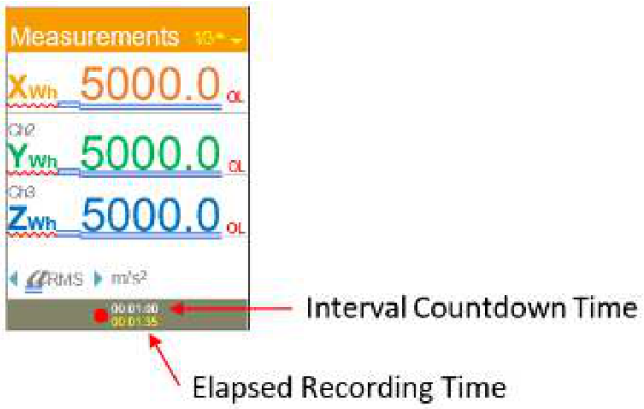

6.7 Stopping a recording

Pressing the Stop key during an active recording will display the available options.

Saving the recording

Select Yes by pressing Soft Key 2.

Discarding the recording


Select No by pressing Soft Key 1 to return to Real Time mode.

6.8 Reviewing saved measurements

File Review can be accessed by either manually loading a file under File Manager or by enabling the Auto Playback function (see below).

File Review allows you to view measurement information for any recordings saved on your instrument.

The main File Review screen displays general measurement information, as shown below.

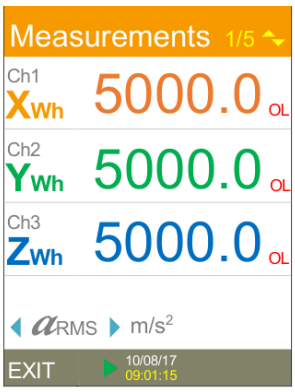

You can scroll through other measurement screens as normal using the Up and Down arrow keys to view parameter information.


Exiting file review

Select Exit using the Soft key 1 to quit File Review and return to Real Time mode.

6.9 Automatic playback

Auto Playback is located in the File Manager section of the Main Menu, and can be enabled or disabled by pressing OK.

When enabled, after a recording has been saved, your Pulsar vB² will automatically enter File Review instead of returning to Real Time mode.

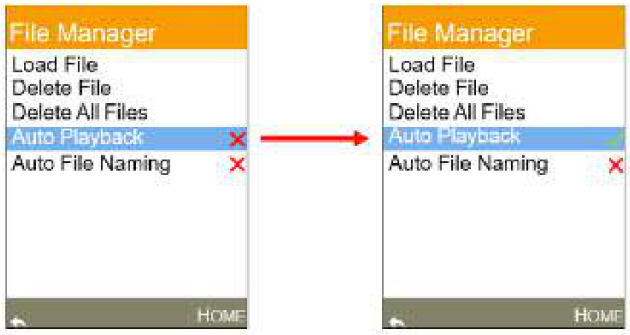

7 Software


The Pulsar vB² offers the perfect option for data analysis software: the PC-based software vBPlus. This provides a simple and free data analysis solution.

Further information can be found in the vBPlus manual.

8 Menus and settings

Menu Structure

The complete menu structure is shown below

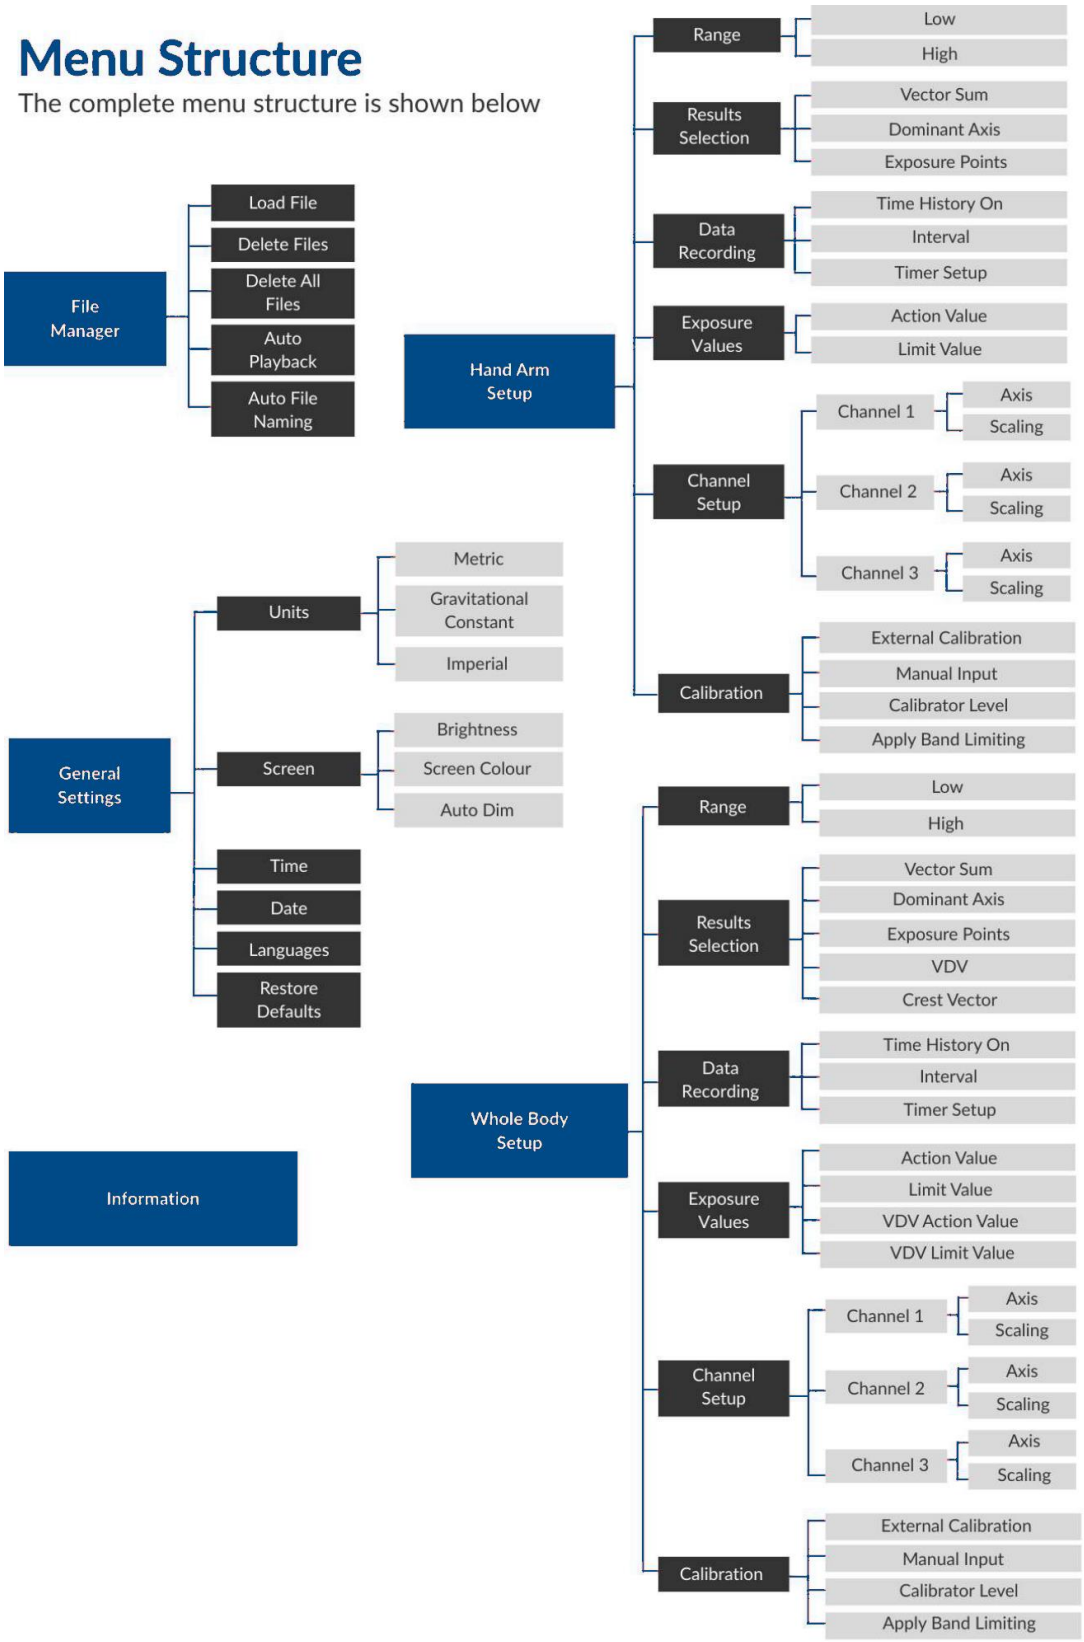


8.1 Menu navigation and settings

The Main Menu can be selected using Soft Key 1 when labelled as Menu.

On most screens within the Pulsar vB² menu system, Soft Key 1 can be used to go back to the previous screen; this will be displayed using the symbol when available.

Similarly, Soft Key 2 can be used to go back to the measurement screen; this will be displayed as Home when available.

The Main Menu is not available when the vibration level meter is recording: -

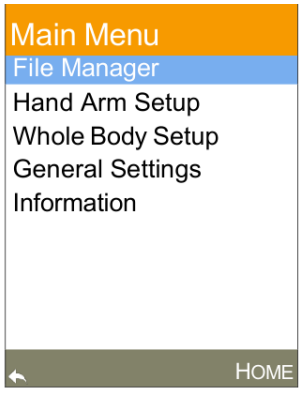


Scroll the available options using the Up or Down Arrow keys, press OK to choose the highlighted section.

Hold down the Directional Arrow keys to rapidly amend or scroll selections.

8.2 File manager

Select File Manager to load saved files, delete saved files and toggle Auto Playback off/on.

Option availability will depend on data files being saved: -

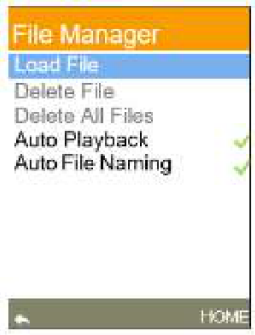

No Files Saved



Files Saved

Scroll the available options using the Up or Down Arrow keys, and press OK to choose from the following: -


•Load File •Delete File •Delete All Files •Auto Playback •Auto File Naming

8.3 Loading a file

Scroll the saved data files using the Up or Down Arrow keys, and press the OK Key to open the selected file in File Review mode.

The file number and total number of data files saved are located at the top left-hand side of the list.

The Left or Right Arrow keys can be used to scroll the data files by page.

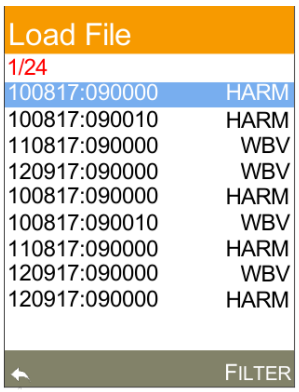


Press Soft Key 2 labelled Filter to open a new window for file filtering options.

Filter selection

Filter the list of saved data files by the selections made.


Scroll the options using the Up or Down Arrow keys, and press the OK key or the Left or Right Arrow keys to toggle each available option.

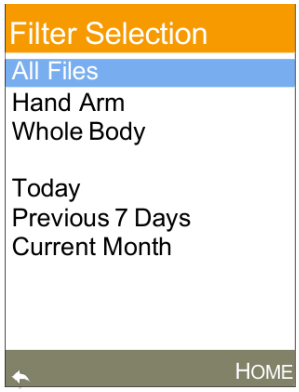

Only one option from All Files, Hand-Arm and Whole-Body can be selected at any time. To be used in conjunction with Today, Previous 7 Days and Current Month.


8.4 Deleting a file

Choose Delete File to delete one individual recording.

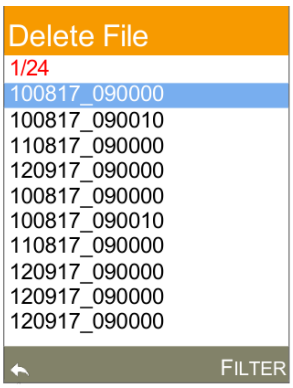

Scroll the available data files using the Up or Down Arrow keys, and press OK to select the file to delete.

The Left or Right Arrow keys can be used to scroll the data files by page.

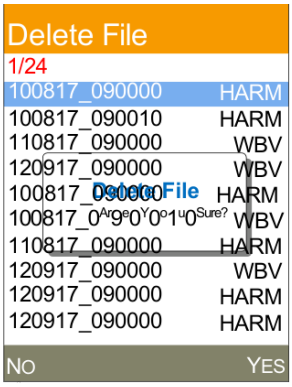


Press Soft Key 1 labelled Yes to delete the selected file.

Press Soft Key 2 labelled No to cancel.

8.5 Deleting all files

Choose Delete All Files to delete all data recordings.

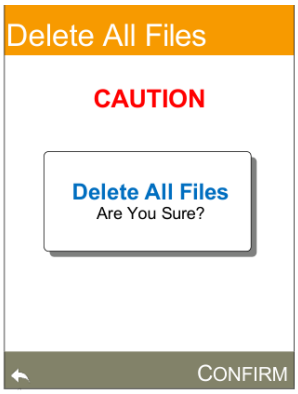


Press Soft Key 1 to cancel and go back to the previous screen.

Press Soft Key 2 labelled Confirm to delete all files.

Deleted files are unrecoverable.

8.6 Automatic playback

When enabled, after a recording has been saved, your Pulsar vB² will automatically enter File Review instead of returning to Real Time mode.

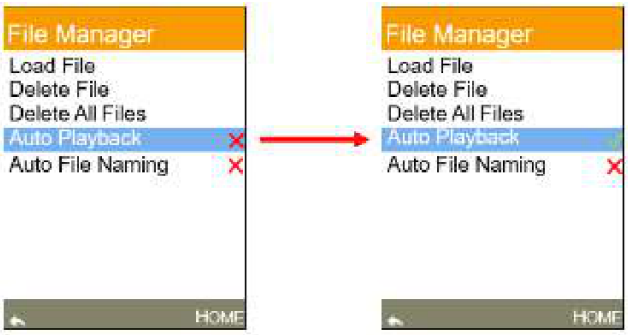

Press the Left or Right Arrow keys or the OK key to toggle the selection.

8.7 Automatic file naming

When enabled, after a recording has stopped, if the file is saved, Pulsar vB² will automatically save it and assign a file name. The filename is based on the Time and Date at the start of the measurement.



Press the Left, Right Arrow Keys or the OK Key to toggle the selection.

8.8 Hand-arm and whole-body setup

Select either Hand-Arm Setup or Whole-Body Setup depending on the accelerometer you are using to change your recording settings and how information is displayed.

Scroll the available options using the Up or Down Arrow keys, and press OK to choose the highlighted selection.





Range

Select Range to change the measurement range applied to each measurement.

Scroll through the available options using the Up or Down Arrow keys and use the Left or Right Arrow keys to amend the selection.


Depending on the accelerometer attached and unit selection, the ranges may change.





Results selection

Select Results selection to change the results displayed in the playback screens.

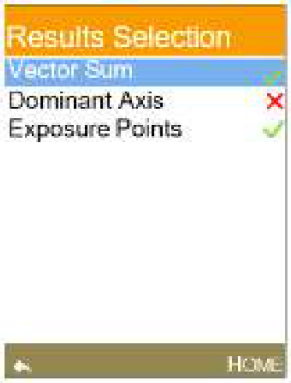

Hand Arm



Whole Body


Data recording

Select Data Recording to enable Time History and to choose any time interval periods required.

The time periods recorded by the instrument are determined by the Time History settings, the settings made within the Timer Setup or by the user manually stopping the recording.

If the Total Recording Time has been set under Timer Setup, this will be shown on the Data Recording screen as the Total Recording Time. If no settings are made with Timer Setup, then Not Set will be shown.



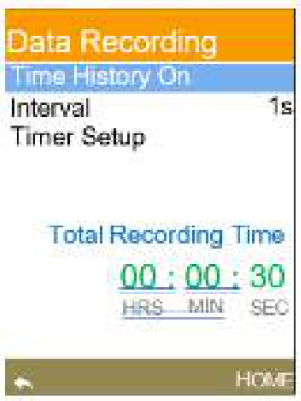

Scroll the available options using the Up or Down Arrow keys.

Press OK or the Left or Right Arrow keys to toggle Time History On.


Use the Left or Right Arrow keys to amend the value for the Interval time setting.

Press the OK key to select Timer Selection.

Time history disabled

If Time History On is disabled, then all data recordings made will not contain any Time History data and the Interval settings become unavailable.

In this case, the instrument will record one set of measurements over the total measurement time.

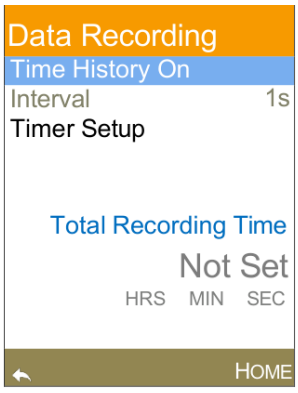

Interval

When Time History On is enabled, each recording will calculate data over the Interval time selected.


The available options for Interval periods are as follows: -

- 1s, 10s, 1m, 5m, 10m, 15m, 30m, 1hr, 8hr, 12hr

Calculations over Interval Periods are not displayed on screen

Timer setup

Choose Timer Setup to set the overall automatic recording length.

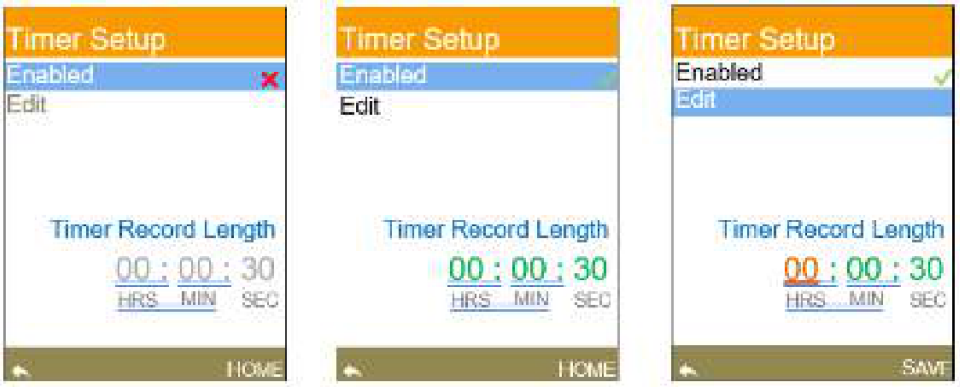

Press OK to enable the Timer.

Use the Up or Down Arrow keys to highlight Edit, and then press OK to edit the Timer Record Length.

Use the Left or Right Arrow keys to move and highlight the selection to change. Use the Up or Down Arrow keys to amend the selection. The Timer Record Length can be used with or without Time History enabled.

The settings can be amended as shown below: -

- 00 to 23 HRS, 00 to 59 MIN, 00 to 59 SEC

Once a recording is started, it will run for the set Timer Record Length and will then stop. If Auto File Naming is selected, the file will save automatically; otherwise, the file naming screen will be shown.

If the file is stopped before the set Timer Record Length ends, the measurement will stop and a Save File? window will be shown. To save the file, press Soft Key 2 labelled YES. If Auto File Naming is selected, the file will save automatically; otherwise, the file naming screen will be shown.


8.9 Exposure values

The Exposure menu allows you to alter how your Pulsar vB² records Exposure data.

Scroll the available options using the directional Arrow keys and press the OK key to change the highlighted selection.


Hand-arm exposure values




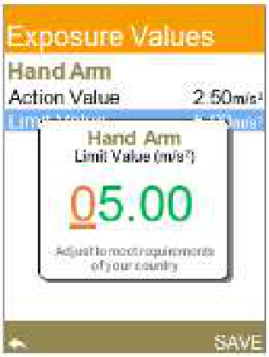

The default Hand-Arm Exposure Values are 2.5 m/s² and 5.0 m/s² for the Action and Limit values, respectively, under EU and UK law. Please refer to your local legislation to determine the correct values to set these to.

Whole-body exposure values

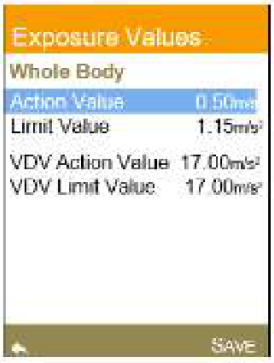

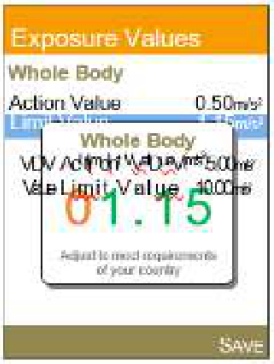

The default values for Whole-Body Exposure Values are 0.5 m/s² and 1.15 m/s² for the Action and Limit Values, respectively, according to EU and UK law. Please refer to your local legislation to determine the correct values to set these to.

The whole-body exposure values also require a VDV Action value of 17.0 m/s² and a VDV Limit value of 17.0 m/s². These are set according to the current UK guidance but can be changed to suit your local legislation.

8.10 Channel setup

The Pulsar vB² also lets you modify the channel settings. Changing these settings is advised for advanced users only.



Use the Up or Down Arrow keys to scroll the selection.

Axis

Use the Left or Right Arrow keys to change the Axis.

This advanced option lets the user swap the direction of accelerometer axis inputs for custom accelerometer fitment.

Scaling

Use the Left or Right Arrow keys to change the Scaling.

This advanced option allows the user to change the scaling factor applied to each axis for Whole-Body Vibration only.

Default values are X, Y = 1.4 and Z =1.0

Scaling is not available for Hand-Arm Vibration.


8.11 Calibration

Select Calibration to calibrate your Pulsar vB² vibration level meter.

It is recommended that you perform the calibration procedure before and after measurements have been taken using the calibrator.

The Pulsar vB² features three alternatives for field calibration; these are as follows:

- External Calibration
- Manual Input
- Calibrator Level

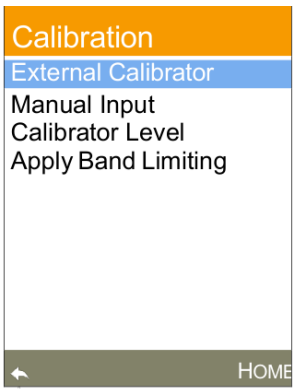

Use the Arrow keys to highlight the calibration option you wish to use and select with the OK key. The appropriate calibration screen will then appear.

You may also toggle the Apply Band Limiting option in this menu; doing so will apply a band-limited filter to all channels. Band limiting filters are useful for calibration and testing.

External calibrator



Use the Up or Down Arrow keys to scroll the selection.

Use the OK key to choose the selection and begin the calibration to the set Calibrator Level for the selected channel/axis.

The message Calibrating Please Wait is shown until the calibration is complete.

A message displaying Calibration Passed will appear after a successful calibration; if unsuccessful, Calibration Failed will appear.

Manual calibration input

Use the Up or Down Arrow keys to scroll the selection.

Use the OK key to choose the selection.



Use the Left or Right Arrow keys to change the selection and move the cursor. Use the Up or Down Arrow keys to amend the value of the selection.

Press Soft Key 2 to save the axis offset.

These values can be found on the calibration certificate provided with your Pulsar vB²

vibration meter.

Calibrator level

Use the Left or Right Arrow keys to change the selection and move the cursor.

Use the Up or Down Arrow keys to amend the value of the selection.



For Hand-Arm vibration, the limits are as follows: -

- 00.00 to 99.99


For Whole-Body vibration, the limits are as follows: -

- 00.00 to 99.99

Press Soft Key 2 to save the Calibrator level.

8.12 General settings

Select General Settings from the main menu to access instrument settings.

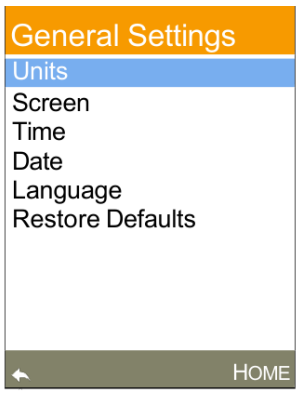

Scroll the available options using the Up or Down Arrow keys, and press OK to choose from the following: -

- Units
- Screen
- Time
- Date
- Languages
- Restore Defaults

Units

Select Units to change the unit of measurement your values are displayed in.





Use the Up or Down Arrow keys to scroll the selection.

Use the OK or Left / Right Arrow keys to enable the selection.

Only one option can be selected at any time.

8.13 Screen

Select Screen to alter the screen colour and access power-saving features.




Brightness

Use the Left and Right Arrow keys to adjust the screen brightness as required.

Increased screen brightness reduces battery operating time.

Screen colour

Use the Left and Right Arrow keys to toggle the screen colour between White and Black: -

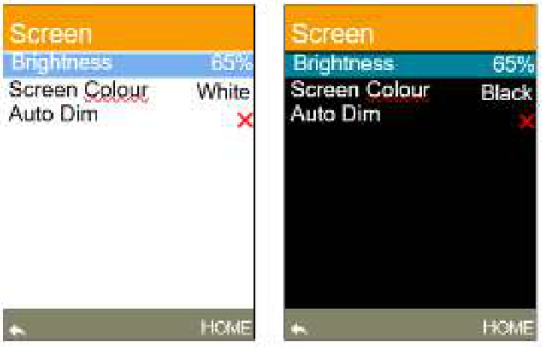

Auto dim

The Auto Dim feature automatically dims the screen after a set period to reduce power use and increase battery run time.

Use the Left and Right Arrow keys to adjust the Auto Dim as below: -

- Off or 1 to 15 (minutes) - 1 min recommended.

Pressing any key whilst Auto Dim is active will return the screen to its standard brightness setting.

8.14 Date

Enter the current date using the date format specific to your region.




Use the Up and Down Arrow keys to adjust the value.

Use the Left and Right Arrow keys to move forward or back.

Press Soft Key 2 labelled Save to accept the date changes.

8.15 Time

Enter the current date using the time zone specific to your region.

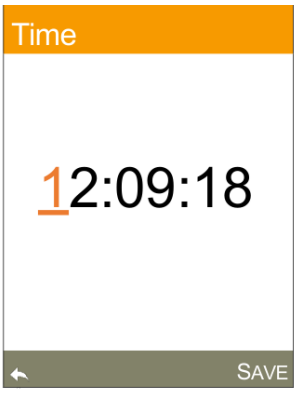

Use the Up and Down Arrow keys to adjust the value.

Use the Left and Right Arrow keys to move forward or back.

Press Soft Key 2 labelled Save to accept the date changes.

8.16 Language

Select to change the operating language of the instrument.




Scroll the options using the Up or Down Arrow keys and press Soft Key 2 to confirm selection.

Language options are not available on all models.

8.17 Restore defaults

Restore Defaults gives you the option to restore all instrument settings to their factory default.

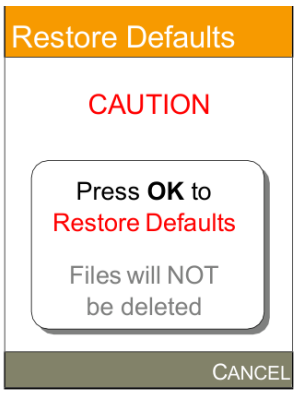


Use the OK key to choose the selection and restore all factory default settings except for Language.

Press Soft Key 2 labelled CANCEL to return to the previous screen without making any changes.

8.18 Information

Select to show instrument-specific information.

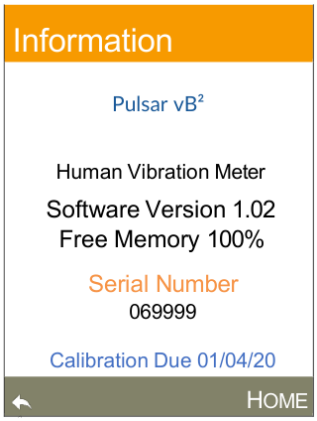

This will include the name of the meter, software version, memory available, serial number and calibration due date.

9 Measurement screens

The Pulsar vB² vibration level meter provides various measurement screens.

Scroll the available measurement screens using the Up or Down Arrow keys.

9.1 Measurement screen 1

Your Pulsar vB² instrument will always show the Measurement Screen below after powering up, defaulting to aRMS: -



The correct weighting filter is shown for each channel and cannot be changed regardless of which mode of vibration is being measured, Hand-Arm or Whole-Body.

The frequency weightings are as follows: -

- Hand-Arm: X, Y, Z = Wh
- Whole-Body: X, Y = Wd, Z = Wk

Press either the Left or Right Arrow Keys to scroll between the available parameters in the following order: -

- aRMS, aEQ, aPK, aCF*, aVDV* (*Only available for WBV and if enabled)

Press either the Up or Down Arrow Keys to scroll between the measurement screens.

Press OK to start a recording.

Press Soft Key 2 labelled RANGE to immediately change the measurement range.

9.2 Measurement screen 2


Press either the Up or Down Arrow Keys to scroll between the measurement screens.

The screen below features exposure time; press Soft Key 2 labelled TIME to adjust the Exposure Time.

Press either the Left or Right Arrow Keys to scroll between HRS and MIN. Press either the Up or Down Arrow Keys to change the value of HRS or MIN.

- HRS 00 to 23
- MIN 00 to 59

Press Soft Key 2 labelled SAVE to save the entered Exposure Time.

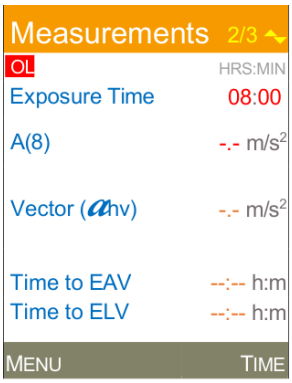

Changing the Exposure Time will re-calculate the A(8) value only.

Press either the Up or Down Arrow Keys to scroll between the measurement screens.

Press OK to start a recording.

9.3 Measurement screen 3

Press either the Up or Down Arrow Keys to scroll between the measurement screens.

If A(8) is selected, press Soft Key 2 labelled TIME to adjust the Exposure Time.

Press either the Left or Right Arrow Keys to scroll between HRS and MIN.

Press either the Up or Down Arrow Keys to change the value of HRS or MIN.

- HRS 00 to 23
- MIN 00 to 59

Press Soft Key 2 labelled SAVE to save the entered Exposure Time.



Changing the Exposure Time will re-calculate the A(8) value only.

Press either the Left or Right Arrow Keys to scroll between the available parameters.

Press either the Up or Down Arrow Keys to scroll between the measurement screens.

Press OK to start a recording.

In Real Time Mode, calculated parameters will be blank, showing -.- or similar.

In File Review Mode, extra screens will be available, including an Information Screen.

10 Customer support

10.1 Warranty and after-sales service

At Pulsar Instruments, we design and manufacture precision instruments, which, if treated with reasonable care and attention, should provide many years of service.

In the event of a fault occurring under warranty, this instrument should be returned to Pulsar Instruments plc with a clear description of the fault or symptom. You can speak to a member of our team to confirm how to return the instrument.

Details of the warranty cover are available on our website at https://pulsarinstruments.com/service/customer-support/.

To speak to a member of our support team, please contact:

Phone: +44 1723 339715.

Website Live Chat: https://pulsarinstruments.com/.